



MICROCHIP PIC18F6627/6722/8627/8722

PIC18F6627/6722/8627/8722 Rev. B1 Silicon Errata

The PIC18F6627/6722/8627/8722 Rev. B1 parts you have received conform functionally to the Device Data Sheet (DS39646C), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F6627/6722/8627/8722 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

The following silicon errata apply only to PIC18F6627/6722/8627/8722 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F6627	0001 0011 110	0 0010
PIC18F6722	0001 0100 000	0 0010
PIC18F8627	0001 0011 111	0 0010
PIC18F8722	0001 0100 001	0 0010

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFFh in the device's configuration space. They are shown in binary in the format "DEVID2 DEVID1".

All of the issues listed here will be addressed in future revisions of the PIC18F6627/6722/8627/8722 silicon.

1. Module: Master Synchronous Serial Port (MSSP) — Serial Peripheral Interface (SPI)

In SPI mode, the Buffer Full flag (BF bit in the SSPxSTAT register), the Write Collision Detect bit (WCOL in SSPxCON1) and the Receive Overflow Indicator bit (SSPOV in SSPxCON1) are not reset upon disabling the SPI module (by clearing the SSPEN bit in the SSPxCON1 register).

For example, if SSPxBUF is full (BF bit is set), and the MSSP module is disabled and re-enabled, the BF bit will remain set. In SPI Slave mode, a subsequent write to SSPxBUF will result in a write collision. Also, if a new byte is received, a receive overflow will occur.

Work around

Ensure that if the buffer is full, SSPxBUF is read (thus clearing the BF flag) and WCOL is clear before disabling the MSSP module. If the module is configured in SPI Slave mode, ensure that the SSPOV bit is clear before disabling the module.

Date Codes that pertain to this issue:

All engineering and production devices.

2. Module: Capture/Compare/PWM (CCP)

PWM output of 10-bit resolution is not available for either CCP4 or CCP5 when Timer4 is being used as the PWM time base (T3CON<6,3> = 01, 10 or 11) for the PWM mode (CCPxCON<3:2> = 11).

Work around

For 10-bit resolution, use Timer2 as the PWM time base (T3CON<6,3> = 00).

For 8-bit resolution, use Timer4 or Timer2 as the PWM time base and set the two LSBs to '00' (CCPxCON<5:4> = 00).

Date Codes that pertain to this issue:

All engineering and production devices.

3. Module: MSSP (I²C™ Slave)

In extremely rare cases, when configured for I²C™ slave reception, the MSSP module may not receive the correct data. This occurs only if the Serial Receive/Transmit Buffer Register (SSPxBUF) is not read within a window after the SSPxIF interrupt has occurred.

For SSP1BUF, the flag bit is SSP1IF (PIR1<3>). For SSP2BUF, the flag bit is SSP2IF (PIR3<7>).

Work around

The issue can be resolved in either of these ways:

- Prior to the I²C slave reception, enable the clock-stretching feature.

This is done by setting the SEN bit (SSP1CON2<0>).

- Each time the SSPxIF bit is set, read the SSPxBUF before the first rising clock edge of the next byte being received.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F6627/6722/8627/8722

4. Module: MSSP (I²C™ Master)

If the module is in I²C Master mode and the slave performs clock stretching, the first clock pulse after the slave releases the SCL line may be narrower than the configured clock width. This may result in the slave missing the first clock in the next transmission/reception.

Work around

If the module is in I²C Master mode, do not have the slave perform clock stretching. Alternately, the master can slow down the SCL clock frequency to a level where the slave can detect the narrowed clock pulse.

Date Codes that pertain to this issue:

All engineering and production devices.

5. Module: Enhanced Universal Synchronous Asynchronous (EUSART)

In rare situations when interrupts are enabled, unexpected results may occur if:

- The EUSART is disabled (the SPEN (RCSTAx <7>) bit = 0)
- The EUSART is re-enabled (RCSTAx <7> = 1)
- A two-cycle instruction is executed

Work around

Add a 2-TcY delay after re-enabling the EUSART.

1. Disable the receive interrupts:
 - For RCSTA1 – RC1IE bit (PIE1<5>) = 0
 - For RCSTA2 – RC2IE bit (PIE3<5>) = 0
2. Disable the EUSART:
 - For RCSTA1 – SPEN bit (RCSTA1<7>) = 0
 - For RCSTA2 – SPEN bit (RCSTA2<7>) = 0
3. Re-enable the EUSART (RCSTAx <7> = 1). (See step 1.)
4. Re-enable the receive interrupts:
 - For RCSTA1 – RC1IE bit (PIE1<5>) = 1
 - For RCSTA2 – RC2IE bit (PIE3<5>) = 1
(This is the first TcY delay.)
5. Execute a NOP instruction.
(This is the second TcY delay.)

Date Codes that pertain to this issue:

All engineering and production devices.

6. Module: Timer1

When Timer1 is running on the Timer1 oscillator, if Sleep mode is executed immediately after loading Timer 1 with 0xFFFF, the Timer1 interrupt will not get set on the first overflow from 0xFFFF to 0x0000.

All subsequent overflows, from 0xFFFF to 0x0000, will work correctly.

Work around

None.

Date Codes that pertain to this issue:

All engineering and production devices.

REVISION HISTORY

Rev A Document (8/2007)

Initial release of this errata. Includes silicon issues 1 (MSSP) and 2 (CCP).

Rev B Document (2/2009)

Added silicon issues 3 (MSSP – I²C Slave), 4 (MSSP – I²C Master), 5 (Enhanced Universal Synchronous Asynchronous – EUSART) and 6 (Timer1).

PIC18F6627/6722/8627/8722

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, rfPIC, SmartShunt and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, nanoWatt XLP, PICkit, PICDEM, PICDEM.net, PICtail, PIC³² logo, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rfLAB, Select Mode, Total Endurance, TSHARC, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2009, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==

Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://support.microchip.com>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland

Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo

Kokomo, IN
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

Santa Clara

Santa Clara, CA
Tel: 408-961-6444
Fax: 408-961-6445

Toronto

Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office

Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney

Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing

Tel: 86-10-8528-2100
Fax: 86-10-8528-2104

China - Chengdu

Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Hong Kong SAR

Tel: 852-2401-1200
Fax: 852-2401-3431

China - Nanjing

Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao

Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai

Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang

Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen

Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Wuhan

Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xiamen

Tel: 86-592-2388138
Fax: 86-592-2388130

China - Xian

Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

China - Zhuhai

Tel: 86-756-3210040
Fax: 86-756-3210049

ASIA/PACIFIC

India - Bangalore

Tel: 91-80-3090-4444
Fax: 91-80-3090-4080

India - New Delhi

Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune

Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama

Tel: 81-45-471- 6166
Fax: 81-45-471-6122

Korea - Daegu

Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul

Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur

Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang

Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila

Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore

Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu

Tel: 886-3-572-9526
Fax: 886-3-572-6459

Taiwan - Kaohsiung

Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan - Taipei

Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok

Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels

Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen

Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris

Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich

Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan

Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen

Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid

Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham

Tel: 44-118-921-5869
Fax: 44-118-921-5820