

Active Errata List

- USB – Ping-Pong databank 1 Re-transmission Failure
- USB – Ping-Pong OUT Bad Reception
- USB – Bad Remote Wake-up Generation
- UART Interface – During Reception, Clearing REN may Generate Unexpected IT
- C51 Core – Power-down Exit Failure in X2 Mode
- Timer 0/1 – Unexpected Interrupt
- USB Interface – Data Corruption in Endpoint0 and FIFO
- Timer 2 – Baud Rate Generator – Long Start Time
- PLL Filter Values for USB Certification
- Powerdown Mode Generates a Reset
- Bad Suspend Resume Initialization
- Stretch MOVX Does Not Work

Errata History

Lot Number	Errata List
A04085, A04085B, A04086A, A04086C, A04086G, A04086J, A04271B, A04271C, A04271E, A04273, A04273B, A04273C, A04273D, A04273E, A04273L, A04273R	1, 2, 3, 4, 5, 6, 7, 8, 9,11, 12, 13, 14
A03707	1, 2, 3, 4, 5, 6, 7, 8, 9,10,11,12,13,14
A04271A, A04271M, A04591, A04592, A04593, A04760, A04761, A04759 and above	1, 2, 3, 4, 5, 6, 7, 8, 9,10,12,14

Errata Description

1. USB – Ping-Pong Databank 1 Re-transmission Failure

When the host does not acknowledge an IN data packet from the databank 1 of a ping-pong endpoint, the endpoint retry-mechanism sends corrupted data. Then a normal USB traffic takes place.

Workaround

None.


2. USB - Ping-Pong OUT Bad Reception

When the host sends a packet with a size lower than the size defined in the DPRAM endpoint (Ping-Pong Only), there is a risk of having a corrupted packet in the DPRAM with a wrong number of bytes reported. This problem occurs only in Ping-Pong mode if the 2 banks are full and bank 1 is cleared when the host is sending a packet at that time. If the packets are of the size of the DPRAM endpoint, there is no problem even in Ping-Pong mode.

If the device application software is quick enough to read the received packets to avoid the case where the 2 banks are full, there is no problem even if the packet sizes are not of the same size of the DPRAM endpoint.

Workaround

None.

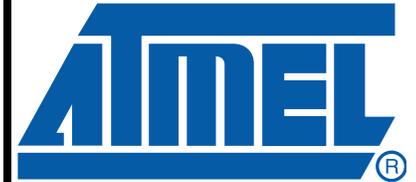

USB Microcontrollers

AT89C5131A-L

Errata Sheet



3. USB - Bad Remote Wake-up Generation

The remote wake-up generates an SE0 and J state (at the end of the Upstream Resume K) that are reserved by the Host. When a device is in suspend state and wants to notify an event to the host, it can send an upstream resume in order to wake up the host. The upstream resume consists of emitting a K state between 1 ms and 15 ms. At the end of this period, the device should leave the bus in idle state (J state) and wait for a SOF coming before 3ms. But at the end of the upstream resume, the USB controller drives a SE0 (D+ and D- at 0 for 2 bit time) during 100ns before driving the J state.

Workaround

None.

4. UART Interface – During Reception, Clearing REN may Generate Unexpected IT

During UART reception, if the REN bit is cleared between start bit detection and the end of reception, the UART will not discard the data (RI is set).

Workaround

Test REN bit at the beginning of interrupt routine just after CLR RI, and run the Interrupt routine code only if REN is set.

5. C51 Core – Power-down Exit Failure in X2 Mode

If CPU is configured in X2 mode when exiting from power down, the first address fetched may be lost

Workaround Two solutions are possible:

a) Set CPU in X1 mode before entering in power-down mode and then restore CPU to X2 mode when the CPU is woken up.

b) Add a NOP (0x00) opcode just after the instruction which activates the power down mode. As this NOP is randomly non executed, the behavior of the software is correct.

Example:

```
MOV PCON, #02H; Power down mode activation
```

```
NOP ; This NOP is randomly not executed
```

```
..... ; Put here the first opcode to execute after exiting from power down mode
```

6. Timer 0/1 – Unexpected Interrupt

If one of the timers 0 and 1 is in X1 mode while the other one is in X2 mode, an unexpected interrupt may randomly occur for one of the timers.

Workaround

Use the same mode X1 or X2 for both timers. This condition is met if PLL is used to clock the CPU.

7. USB Interface – Data Corruption in Endpoint0 and FIFO

Data in Control Endpoint and FIFO may be corrupted if USB macro and CPU write in simultaneously. This condition occurs if the host cancels a control IN transaction with premature OUT and sends the following SETUP while the C51 is writing into the FIFO instead of the cancellation.

Workaround:

Use 32 bytes FIFO to avoid fragmented data transaction on Control Endpoint.

8. Timer 2 – Baud Rate Generator – Long Start Time

When Timer 2 is used as a baud rate generator, TH2 is not loaded with RCAP2H at the beginning, then UART is not operational before 10,000 machine cycles.

Workaround


Add the initialization of TH2 and TL2 in the initialization of Timer 2.

9. PLL Filter Values for USB Certification

The current filter values recommended in the datasheet, $R1/C1/C2= 100\Omega/10nF/2.2nF$, cannot pass USB certification, due to signal rate (11.95MHz) out of specification (11.97 MHz - 12.03MHz) .

Workaround

Apply new PLL filter values: $R1/C1/C2= 560\Omega/820pF/150pF$.

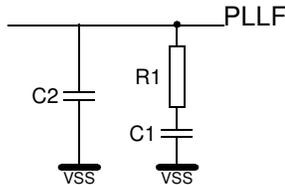

10. Powerdown Mode Generates a Reset

A reset is generated when entering the Powerdown mode.

Workaround

None.

11. Wrong Latch of Hardware Conditions

If the Reset input is controlled externally and is not synchronous with internal clock, the Hardware Conditions could be latched in the wrong status. These hardware conditions are used in the boot process and the device may not boot in the right target (Bootloader or Application)

Workaround

- 1) The internal synchronous Reset provided by the POR/PFD feature guarantees a reliable Reset at power-up.
- 2) The internal Hardware Watchdog Reset can also be used without failure.

12. USB Interface – Bad Suspend Resume Initialization

Sometimes and randomly when the USB device is plugged to the USB interface, it may not enumerate properly. It appears that the device remains in suspend state.

Workaround

After enabling the USB macro by means of bit USBE bit in USBCON, it is necessary to clear just after the bit WUPCPU in USBINT register

13. USB Interface – CPU Wake-up Interrupt Not Cleared

The WUPCPU bit in USBINT register is set by the hardware when the USB macro exits from suspend mode. The firmware acknowledges this event by clearing the WUPCPU bit in the interrupt routine. This bit fails to be cleared by software, therefore the USB Wake-up interrupt is not acknowledged and always executed until next suspend state.

Workaround

Disable WakeUp interrupt after resume sequence.

14. Stretch MOVX Does Not Work

When setting M0 bit in AUXR SFR (08Eh), the RD or WR pulse on a MOVX instruction on external memory is not 30 XTAL length but always standard 6 XTAL length. Thus slow external peripherals mapping in the XDATA space could not work properly.

Workaround

None.



Headquarters

Atmel Corporation
2325 Orchard Parkway
San Jose, CA 95131
USA
Tel: 1(408) 441-0311
Fax: 1(408) 487-2600

International

Atmel Asia
Room 1219
Chinachem Golden Plaza
77 Mody Road Tsimshatsui
East Kowloon
Hong Kong
Tel: (852) 2721-9778
Fax: (852) 2722-1369

Atmel Europe
Le Krebs
8, Rue Jean-Pierre Timbaud
BP 309
78054 Saint-Quentin-en-
Yvelines Cedex
France
Tel: (33) 1-30-60-70-00
Fax: (33) 1-30-60-71-11

Atmel Japan
9F, Tonetsu Shinkawa Bldg.
1-24-8 Shinkawa
Chuo-ku, Tokyo 104-0033
Japan
Tel: (81) 3-3523-3551
Fax: (81) 3-3523-7581

Product Contact

Web Site
www.atmel.com

Technical Support
Enter Product Line E-mail

Sales Contact
www.atmel.com/contacts

Literature Requests
www.atmel.com/literature

Disclaimer: The information in this document is provided in connection with Atmel products. No license, express or implied, by estoppel or otherwise, to any intellectual property right is granted by this document or in connection with the sale of Atmel products. **EXCEPT AS SET FORTH IN ATMEL'S TERMS AND CONDITIONS OF SALE LOCATED ON ATMEL'S WEB SITE, ATMEL ASSUMES NO LIABILITY WHATSOEVER AND DISCLAIMS ANY EXPRESS, IMPLIED OR STATUTORY WARRANTY RELATING TO ITS PRODUCTS INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR NON-INFRINGEMENT. IN NO EVENT SHALL ATMEL BE LIABLE FOR ANY DIRECT, INDIRECT, CONSEQUENTIAL, PUNITIVE, SPECIAL OR INCIDENTAL DAMAGES (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF PROFITS, BUSINESS INTERRUPTION, OR LOSS OF INFORMATION) ARISING OUT OF THE USE OR INABILITY TO USE THIS DOCUMENT, EVEN IF ATMEL HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.** Atmel makes no representations or warranties with respect to the accuracy or completeness of the contents of this document and reserves the right to make changes to specifications and product descriptions at any time without notice. Atmel does not make any commitment to update the information contained herein. Unless specifically provided otherwise, Atmel products are not suitable for, and shall not be used in, automotive applications. Atmel's products are not intended, authorized, or warranted for use as components in applications intended to support or sustain life.

© 2008 Atmel Corporation. All rights reserved. Atmel®, logo and combinations thereof, and others are registered trademarks or trademarks of Atmel Corporation or its subsidiaries. Other terms and product names may be trademarks of others.